



Prairie Mud Service Ltd.

"Serving Western Canada with 24 Hour Drilling Mud Service"

MSDS (Material Safety Data Sheet)

SECTION I: IDENTIFICATION OF PRODUCT

COMPANY: **Prairie Mud Service** DATE: Nov 6, 2009
738 6th Street PHONE: 306-634-3411
Estevan, SK FAX: 306-634-6694

PRODUCT NAME: **HUMALITE (Black Earth Powder)**

PRODUCT USE: Oil well drilling fluid & cement additive
CHEMICAL FAMILY: Natural mineral; leonardite CAS # | 1415-93-6

WORKPLACE HAZARDOUS MATERIALS INFORMATION SYSTEM (WHMIS)

WHMIS CLASSIFICATION: Not a controlled product under WHMIS
WORKPLACE HAZARD: Treat as a nuisance dust; contains < 0.1% silica

TRANSPORTATION OF DANGEROUS GOODS (TDG)


PROPER SHIPPING NAME: Not regulated under TDG
TDG CLASSIFICATION: Not applicable
UN NUMBER (PIN): Not applicable
PACKING GROUP: Not applicable

SECTION II: HAZARDOUS INGREDIENTS

<u>INGREDIENT</u>	<u>PERCENT</u>	<u>CAS NUMBER</u>	<u>LD₅₀Oral-Rat</u>	<u>LD₅₀Inhal-Rat</u>	<u>ACGIH-TLV</u>
			Contains no WHMIS controlled ingredients		

SECTION III: HEALTH HAZARDS

ROUTE OF ENTRY: [] EYE CONTACT [] SKIN [XX] INHALATION [] INGESTION
EYE CONTACT: Particles may cause mechanical irritation.
SKIN CONTACT: Prolonged or repeated contact may irritate skin in some individuals.
INGESTION: No toxic effects expected.

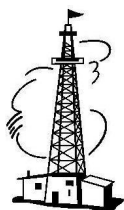

Prairie Mud Service Ltd.

"Serving Western Canada with 24 Hour Drilling Mud Service"

MSDS (Material Safety Data Sheet)

SECTION VI: FIRE AND EXPLOSION HAZARD DATA

FLASH POINT:	Not applicable
FLAMMABLE LIMITS:	Not applicable
EXTINGUISHING MEDIA:	CLASS A is most effective.
SPECIAL FIRE FIGHTING PROCEDURES:	Self-contained breathing apparatus required for fire fighting personnel. Move containers from fire area if possible.
UNUSUAL FIRE AND EXPLOSION HAZARDS:	Fine coal particles dispersed in air represent a potentially explosive mixture. Minimum explosive concentration = 120 mg/m^3 . This product is susceptible to spontaneous heating, which if uncontrolled could lead to combustion.


SECTION VII: REACTIVITY DATA

STABILITY:	STABLE [XX]	UNSTABLE []
INCOMPATIBILITY (CONDITIONS TO AVOID):	Avoid contact with strong oxidizers, heat and ignition sources.	
CONDITIONS OF REACTIVITY:	This product is reactive only at elevated temperatures.	
HAZARDOUS DECOMPOSITION PRODUCTS:	Gaseous oxides of carbon, sulphur and nitrogen. Coal tar products are considered to be human carcinogens (IAR and NTP).	
HAZARDOUS POLYMERIZATION:	WILL NOT OCCUR [XX]	MAY OCCUR []

SECTION VIII: PREVENTATIVE MEASURES

SPECIAL PROTECTION INFORMATION

RESPIRATORY PROTECTION:	NIOSH approved dust mask recommended. Use approved respirator with dust/mist cartridges if TLV is exceeded. ACGIH TWA = 2 mg/m^3 for respirable dust.
VENTILATION:	Use local exhaust ventilation, process enclosure or other engineering control to maintain level of airborne dust below TLV.
PROTECTIVE GLOVES:	Not required, personal preference.
EYE PROTECTION:	Safety glasses with side-shields or goggles are recommended.

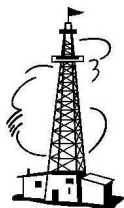

Prairie Mud Service Ltd.

"Serving Western Canada with 24 Hour Drilling Mud Service"

MSDS (Material Safety Data Sheet)

OTHER PROTECTIVE EQUIPMENT (Specify): As appropriate to prevent contact with body. Ensure eyewash station and emergency shower are available.

PRECAUTIONS TO BE TAKEN IN HANDLING AND STORING

Do not breathe dust. Use normal precautions against bag breakage or spills of bulk material. Avoid creation of respirable dust. Use good housekeeping in storage and use areas to prevent accumulation of dust in work areas. Use adequate ventilation and dust collection. Maintain and use proper, clean respiratory equipment. Launder clothing that has become dusty. Empty containers retain product residue and must be handled in accordance with the provision of the MSDS. Store in a cool, dry area. Avoid contact with heat sources, open flames or other ignition sources. Spontaneous heating can result from exposure or product surface to air and by readsorption of moisture lost during processing. The internal temperature of stockpiles or other bulk storage units should be continuously monitored. An enclosed space may become deficient in oxygen available for breathing.

STEPS TO BE TAKEN IN CASE THE MATERIAL IS SPILLED OR RELEASED

Use appropriate safety equipment. Eliminate ignition sources. Avoid creating dust clouds. Vacuum if possible to avoid generating airborne dust. Collect uncontaminated material for repackaging. Collect contaminated material for disposal in an approved container for disposal. Wash spill area with water.

WASTE DISPOSAL METHOD

Dispose in accordance with federal, provincial and local regulations. It is the responsibility of the end-user to determine if material meets the criteria of hazardous waste at the time of disposal. Empty packaging, must be disposed of, or recycled, in accordance with local regulations.

SECTION IX: PREPARATION

The above information is supplied as a customer service and is provided in good faith. Although it has been based on data drawn from sources deemed to be reliable, Prairie Mud Service cannot guarantee its accuracy and assumes no responsibility for conditions resulting from its use.

DATE ISSUED: November 6, 2009

BY: Product safety committee
PHONE: 306-634-3411